



Gato Mecánico a Sin Fin y Corona

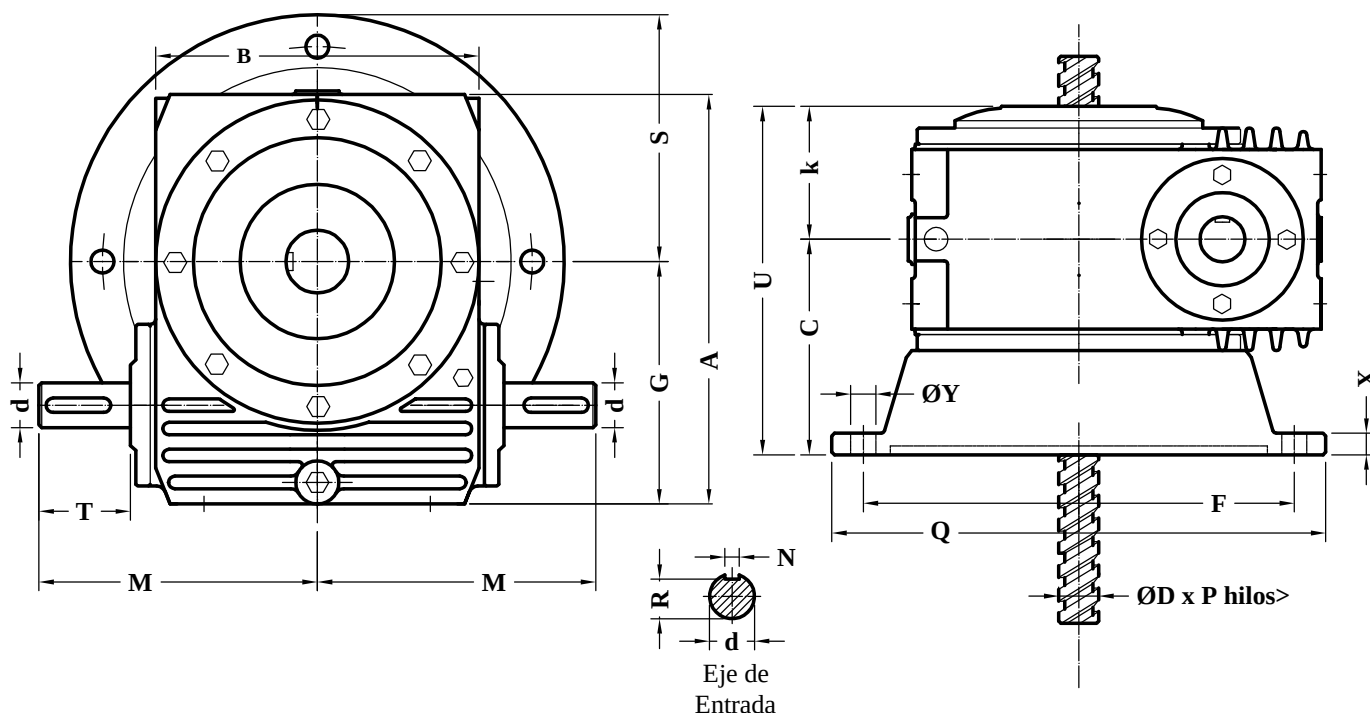


TABLA DE MEDIDAS

MODELO	A	B	C	D Rosca	d	F	G	k	hilos x pulg.	Paso
VFC 35	112	90	65	BSW 3/4"	12	128	65	43	10	2,54
VFC 50	158	130	85	BSW 1"	17	165	90	56	8	3,18
VFC 65	193	160	105	Trapezial 35	20	210	110	65	4	6,35
VFC 80	228	180	120	Trapezial 40	25	240	135	74	4	6,35
VFC 100	285	240	135	Trapezial 50	30	290	165	84	2	12,7
VFC 120	335	280	160	Trapezial 55	35	340	195	100	2	12,7

MODELO	M	N	R	S	T	U	Y	X	Q	Peso Liv.	Peso Ref.
VFC 35	80	4	9,6	72,5	26	110	9	8	145	5	7
VFC 50	110	5	14	92,5	34	145	11	9	185	10	12
VFC 65	135	6	17	117	42	175	11	10	235	16	19
VFC 80	155	8	21	137	51	197	14	12	275	25	29
VFC 100	200	8	26	162	65	225	14	14	325	40	46
VFC 120	235	10	30	187	78	280	18	15	375	63	72



Gato Mecánico a Sin Fin y Corona

Modelo	GMVFC - 35		GMVFC - 50		GMVFC - 65		GMVFC - 80		GMVFC - 100		GMVFC - 120	
Relación	7,3:1	25:1	7,3:1	25:1	7,3:1	25:1	7,3:1	25:1	7,3:1	25:1	7,3:1	25:1
Capacidad Máxima	Liv.	Ref.	Liv.	Ref.	Liv.	Ref.	Liv.	Ref.	Liv.	Ref.	Liv.	Ref.
A la Tracción (kg)	300	420	550	725	925	1400	2750	3850	4750	5800	6800	8500
A Compresión (kg)	350	450	600	800	1000	1500	3000	4000	5000	6000	7000	9000
Torque Necesario (kgm)	7	3	16	9	30	20	47	38	83	70	112	88
HP motor a 750 (rpm)	1	0,5	2,5	1	4,5	2	7	3	12	5	17	6

Diferentes Tipos de Extremos Tornillo

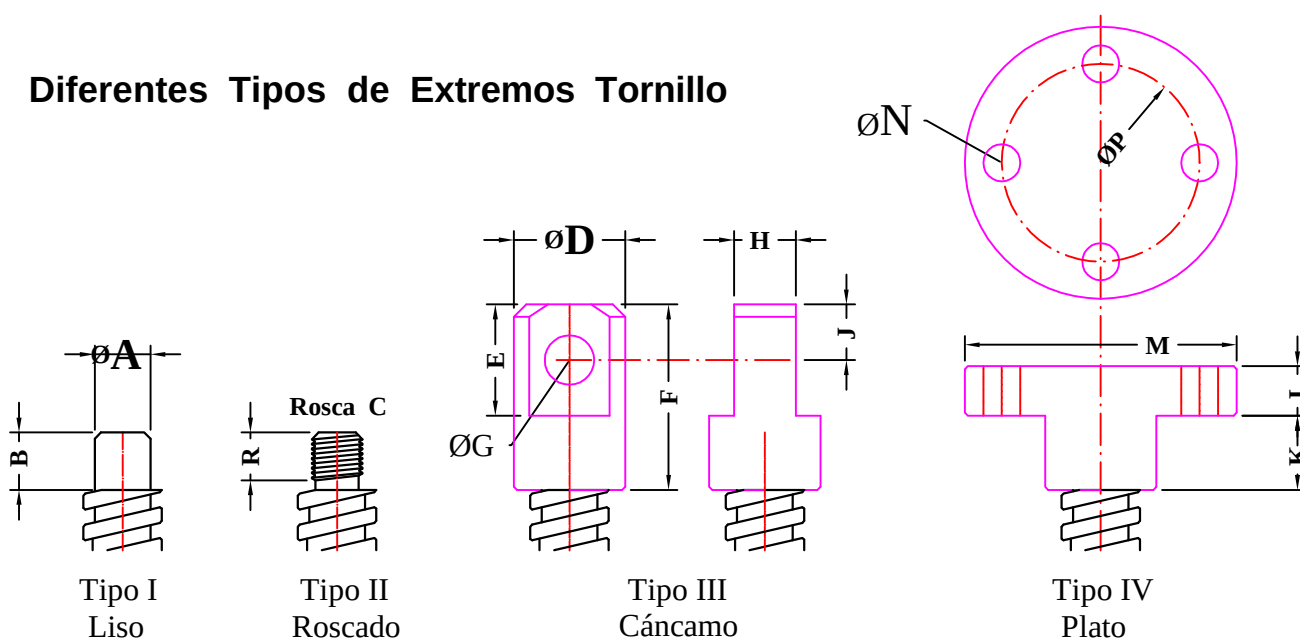


TABLA DE MEDIDAS

Modelo GMVFC	Tipo I		Tipo II		Tipo III						Tipo IV				
	A	B	R	Rosca C	D	E	F	G	H	J	K	L	M	N	P
35	15	20	26	BSW 1/2"	40	22	50	9	28	11	28	12	85	7	63,5
50	19	25	37	BSW 3/4"	50	27	67	10,5	32	13	38	14	103	9	76
65	25	35	50	BSW 1"	70	42	95	17	46	20	53	20	155	14	114
80	33	48	65	BSW 1 1/4"	80	52	120	21	52	25	68	24	185	17	140
100	44	65	75	BSW 1 1/2"	90	77	155	24	58	35	78	28	210	21	152,5
120	48	80	85	BSW 1 1/2"	100	85	185	28	65	40	105	30	240	28	178